

## CMS MOTORHOME INSPECTION FORM

### General Information

Make & Model	Bodan Haughmond Conversion
Reg Number - NO GAP	DU64VTK
HPI Clear	Yes
VAT	No
Engine Size	2.0
BHP	100
Transmission	Manual
Vehicle Weight (kg)	2800
Miles or KM	Miles
Mileage	56145
Confirm miles (within 5,000)	Yes
Is Mileage Warranted	Yes
Engine Keys Count	2
V5 present	Yes
V5 VIN Match	Yes

### Engine Bay

Fluid levels correct?	Yes
Oil/Coolant Contamination	No
Engine bay check	Pass

## CMS MOTORHOME INSPECTION FORM

### Mechanical Inspection

Brake Pedal Pressure Pass	Yes
Handbrake Test Pass	Yes
Static Gear Selection Pass	Yes
Clutch Slip Test Pass	Yes
Steering Noise	No
Engine Noise	No

### Internal Layout

Does internal look original?	Yes
Berths	4
Belts	4
Bed Options	Campervan
Lounge Layout	Two Forward Facing
Layout Correct	Yes
Further Comments	N/A

## CMS MOTORHOME INSPECTION FORM

### Exterior Inspection

External Extras	Alloys, Solar panel, Parking sensors, Reversing camera, LED daytime running lights
Decals	Good
Any Damage Found	Yes
Damage Further Info	Impact to OSR bumper corner // OS high level small dent



Windscreen	No damage
Alloy Wheels	Need attention
Alloy Further Info	Diamond cutting oxidising



Tyres illegal/cracking/out of date	Yes
Tyre Further Info	All 4 perishing in tread pattern




Electric Step	N/A
Self levelling work	N/A
Pop top canvas damage	No

## CMS MOTORHOME INSPECTION FORM

### Internal Inspection

Internal Extras	Cruise control, Diesel heater
Other Extras	N/A
Electrics turn on	Yes
Control panel damaged	No
Stereo turn on	Yes
Smell or signs of smoking	No
Cushions correct	Yes
Boiler present	N/A
Overhead lockers ready	Yes
Internal Damage	Yes
Damage Info	Driver seat outer bolster wear

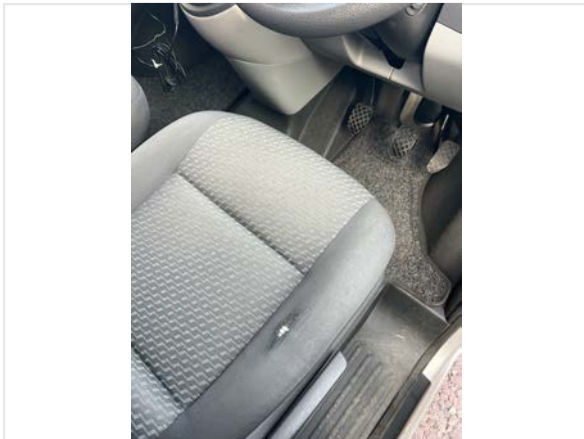






### Damp Inspection

Damp (visible/soft)	No
Floor damp/spongy/damaged	No

# CMS MOTORHOME INSPECTION FORM

## Paperwork

Manuals present	Yes
Engine Service History	Full
Service Info	Latest 25 - 8 stamps
Cam belt changed	Yes
Cam belt info	2025
Habitation service reports	None

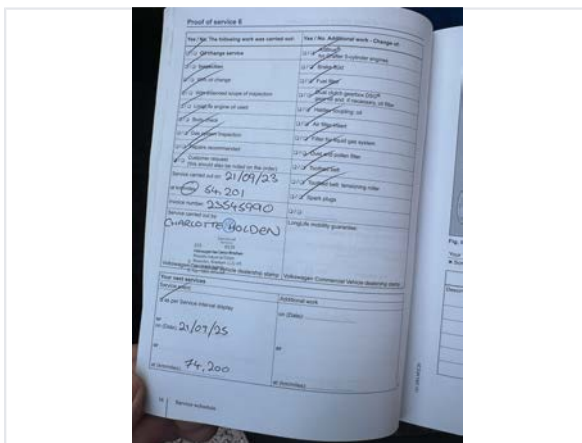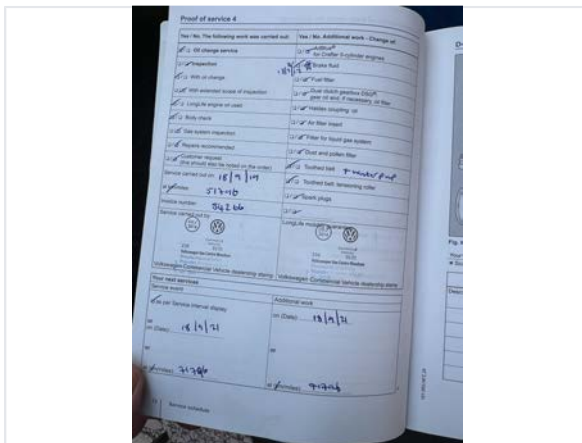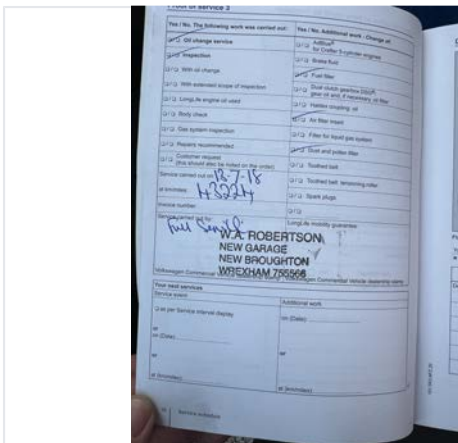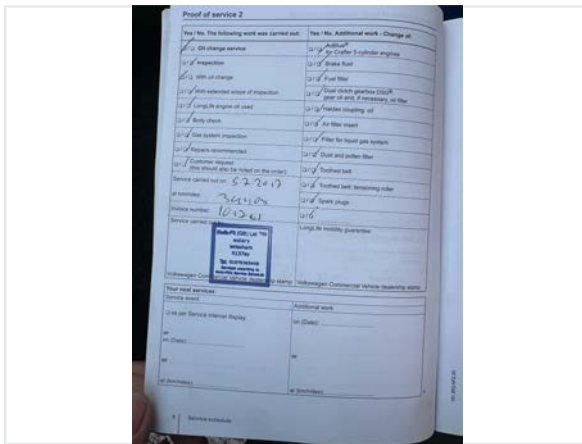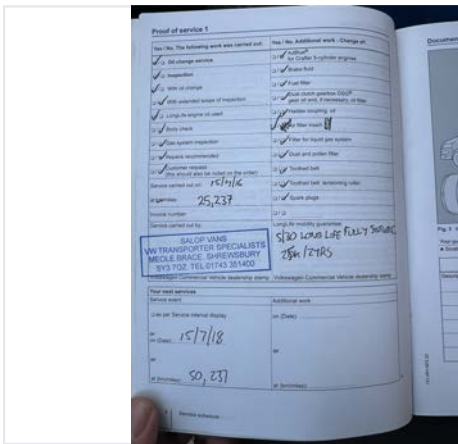

**Proof of service 1**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 12-09-24	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 54992	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: 24054	<input checked="" type="checkbox"/> Long life mobility guarantee

John Roberts Wrexham Tel: 01978 853882

Service event: [ ] Additional work: [ ]

on Date: [ ] on Date: [ ]

at [ ] at [ ]

**Proof of service 2**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 3/10/25	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 56,059	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: 27180	<input checked="" type="checkbox"/> Long life mobility guarantee

John Roberts Wrexham Tel: 01978 853882

Service event: [ ] Additional work: [ ]

on Date: 21/10/26 on Date: [ ]

at [ ] at [ ]

**Proof of service 1**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 15/11/16	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 25,237	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: [ ]	<input checked="" type="checkbox"/> Long life mobility guarantee

WALOP VANS  
WV TRANSPORTER SPECIALISTS  
MEALS BRACE, BARNESBURY  
BY3 7QZ TEL: 01745 261460

Service event: [ ] Additional work: [ ]

on Date: 15/11/18 on Date: [ ]

at [ ] at [ ]

**Proof of service 2**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 5-2-2013	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 76,110	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: 101341	<input checked="" type="checkbox"/> Long life mobility guarantee

Service event: [ ] Additional work: [ ]

on Date: [ ] on Date: [ ]

at [ ] at [ ]

**Proof of service 2**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 18-7-18	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 48324	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: [ ]	<input checked="" type="checkbox"/> Long life mobility guarantee

W. ROBERTSON  
NEW GARAGE  
NEW BOURGTON  
WREXHAM, WY65 6E6

Service event: [ ] Additional work: [ ]

on Date: [ ] on Date: 18/7/18

at [ ] at [ ]

**Proof of service 4**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 18/11/19	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 51716	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: 54266	<input checked="" type="checkbox"/> Long life mobility guarantee

Service event: [ ] Additional work: [ ]

on Date: 18/11/21 on Date: 18/11/19

at [ ] at [ ]

**Proof of service 5**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 2/1/20	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 32041	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: 64271	<input checked="" type="checkbox"/> Long life mobility guarantee

Service event: [ ] Additional work: [ ]

on Date: 2/1/23 on Date: 2/1/20

at [ ] at [ ]

**Proof of service 6**

Yes / No. The following work was carried out:	Yes / No. Additional work - Change oil
<input checked="" type="checkbox"/> Oil change service	<input checked="" type="checkbox"/> Air filter
<input checked="" type="checkbox"/> Suspension	<input checked="" type="checkbox"/> For Clutch 3-cylinder engines
<input checked="" type="checkbox"/> Brake fluid	<input checked="" type="checkbox"/> Brake fluid
<input checked="" type="checkbox"/> With oil change	<input checked="" type="checkbox"/> Fuel filter
<input checked="" type="checkbox"/> With external scope of inspection	<input checked="" type="checkbox"/> Cool check gearbox OILGP gear oil and if necessary, oil filter
<input checked="" type="checkbox"/> Long life engine oil used	<input checked="" type="checkbox"/> Wash coolant oil
<input checked="" type="checkbox"/> Body check	<input checked="" type="checkbox"/> Air filter insert
<input checked="" type="checkbox"/> Clean system inspection	<input checked="" type="checkbox"/> Filter for liquid gas system
<input checked="" type="checkbox"/> Repairs recommended	<input checked="" type="checkbox"/> Cool and pollen filter
<input checked="" type="checkbox"/> Customer request (this should also be noted on the order)	<input checked="" type="checkbox"/> Washed belt
<input checked="" type="checkbox"/> Service carried out on: 21/04/23	<input checked="" type="checkbox"/> Washed belt remaining roller
<input checked="" type="checkbox"/> Mileage: 64,201	<input checked="" type="checkbox"/> Spark plugs
<input checked="" type="checkbox"/> Invoice number: 85845990	<input checked="" type="checkbox"/> Long life mobility guarantee

Service event: [ ] Additional work: [ ]

on Date: 21/07/25 on Date: 21/07/23

at [ ] at [ ]

