

CMS MOTORHOME INSPECTION FORM

General Information

Make & Model	Sunlight A69
Reg Number - NO GAP	FJ09TVX
HPI Clear	Yes
VAT	No
Engine Size	2.4l
BHP	101 bhp
Transmission	Manual
Vehicle Weight (kg)	3500 kg
Miles or KM	Miles
Mileage	36921
Confirm miles (within 5,000)	Yes
Is Mileage Warranted	Yes
Engine Keys Count	2
V5 present	Yes
V5 VIN Match	Yes

Engine Bay

Fluid levels correct?	Yes
Oil/Coolant Contamination	No
Engine bay check	Pass

CMS MOTORHOME INSPECTION FORM

Mechanical Inspection

Brake Pedal Pressure Pass	Yes
Handbrake Test Pass	Yes
Static Gear Selection Pass	Yes
Clutch Slip Test Pass	Yes
Steering Noise	No
Engine Noise	No

Internal Layout

Does internal look original?	Yes
Berths	7
Belts	6
Bed Options	Bench Seats, Bunk Beds, Overcab Bed
Lounge Layout	Two Forward Facing, Bench Seats
Layout Correct	Yes
Further Comments	N/A

CMS MOTORHOME INSPECTION FORM

Exterior Inspection

External Extras	Awning, Electric step, Habitation door lock, Bike Rack, Reversing camera, Solar panel, Tow bar
Decals	Need attention
Decals Further Info	Front decal flaking



Any Damage Found	Yes
Damage Further Info	Stone chips on bonnet Poor repair On near side column behind door Damage on near side and Off side rear bumper Age related bumps and scrapes





Windscreen	Chip(s) smaller than 10p
Alloy Wheels	N/A
Tyres illegal/cracking/out of date	Yes
Tyre Further Info	Tyres are cracking Rears out of date
Electric Step	Fully Working
Self levelling work	N/A
Pop top canvas damage	N/A

CMS MOTORHOME INSPECTION FORM

Internal Inspection

Internal Extras	Bluetooth, cab A/C, Cab blinds, DAB radio, Multifunction steering wheel, Oven, Sat nav
Other Extras	N/A
Electrics turn on	Yes
Control panel damaged	No
Stereo turn on	Yes
Smell or signs of smoking	No
Cushions correct	Yes
Boiler present	Yes
Overhead lockers ready	Yes
Internal Damage	Yes
Damage Info	Surface damaged near sink Shower wall cracked Damage to main table



Damp Inspection

Damp (visible/soft)	No
---------------------	----


Floor damp/spongy/damaged

No

CMS MOTORHOME INSPECTION FORM

Paperwork

Manuals present	Yes
Engine Service History	Partial
Service Info	Five reports. Latest one pictured
Cam belt changed	N/A
Habitation service reports	Partial
Habitation Info	Four reports latest one pictured

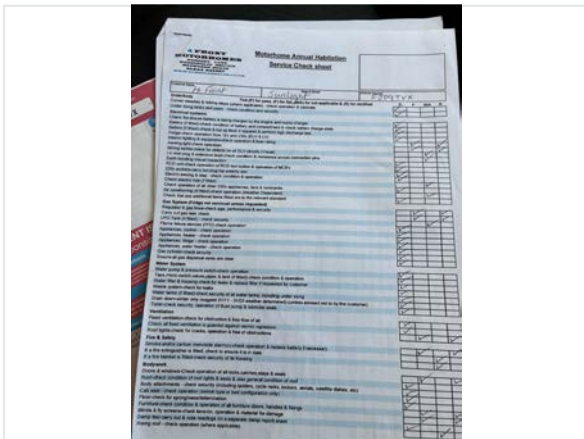

Test Drive & Sign Off

Test drive - 10 mins	Pass
Engine lights	No
Dashboard ghosting/Mileage flashing	No
V5 tested on DVLA	Yes
Completed by	Alan Wileman
Sign-off Date	2026-04-08