

CMS MOTORHOME INSPECTION FORM

General Information

Make & Model	Wildax Constellation 3 XL
Reg Number - NO GAP	YJ19EHZ
HPI Clear	Yes
VAT	Yes
Engine Size	2.2
BHP	140
Transmission	Manual
Vehicle Weight (kg)	3500
Miles or KM	Miles
Mileage	36809
Confirm miles (within 5,000)	Yes
Is Mileage Warranted	Yes
Engine Keys Count	2
V5 present	Yes
V5 VIN Match	Yes

Engine Bay

Fluid levels correct?	Yes
Oil/Coolant Contamination	No
Engine bay check	Pass

CMS MOTORHOME INSPECTION FORM

Mechanical Inspection

Brake Pedal Pressure Pass	Yes
Handbrake Test Pass	Yes
Static Gear Selection Pass	Yes
Clutch Slip Test Pass	Yes
Steering Noise	No
Engine Noise	No

Internal Layout

Does internal look original?	Yes
Berths	2
Belts	3
Bed Options	Bench Seats
Lounge Layout	Bench Seats
Layout Correct	Yes
Further Comments	N/A

CMS MOTORHOME INSPECTION FORM

Exterior Inspection

External Extras	Alloys, Awning, Gaslow, Electric step, Reversing camera, Bike Rack, Parking sensors, Tv Aerial, Solar panel, LED daytime running lights
Other External Extras	N/A
Decals	Good
Any Damage Found	Yes
Damage Further Info	NSR corner plastic crack // two small dents on rear doors // Small stone dent on bonnet



Windscreen	Chip(s) smaller than 10p
------------	--------------------------



Alloy Wheels	
--------------	--

Good	
Tyres illegal/cracking/out of date	No
Electric Step	Fully Working
Self levelling work	N/A
Pop top canvas damage	N/A

CMS MOTORHOME INSPECTION FORM

Internal Inspection

Internal Extras	cab A/C, Bluetooth, Carpets, Cab blinds, Cruise control, DAB radio, Multifunction steering wheel, Oven, Sat nav
Other Extras	N/A
Electrics turn on	Yes
Control panel damaged	No
Stereo turn on	Yes
Smell or signs of smoking	No
Cushions correct	Yes
Boiler present	Yes
Overhead lockers ready	Yes
Internal Damage	Yes
Damage Info	Kitchen blind catch snapped




Damp Inspection

Damp (visible/soft)	No
Floor damp/spongy/damaged	No

CMS MOTORHOME INSPECTION FORM

Paperwork

Manuals present	Yes
Engine Service History	Full
Service Info	5 stamps
Date of Last Engine Service	21/07/25
Cam belt changed	N/A
Habitation service reports	Partial
Habitation Info	N/A
Date of Last Habitation Service	August 2025

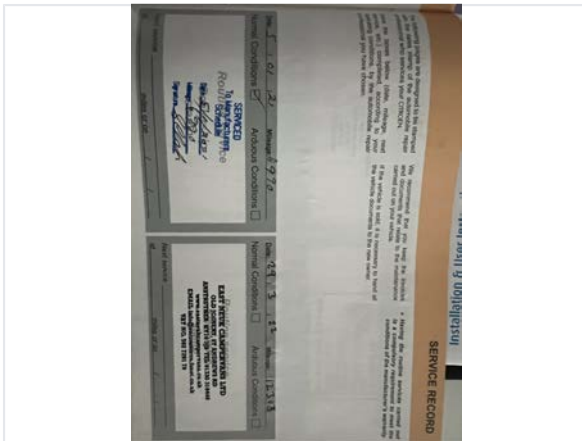

Test Drive & Sign Off

Test drive - 10 mins	Pass
Engine lights	No
Dashboard ghosting/Mileage flashing	No
V5 tested on DVLA	Yes
Completed by	Andrew Rowe

Sign-off Date	2026-05-20